
E.O.	LET	ALTERATION	DATE	BY
E.O. A39642	L	INDICATES CENTERLINES OF NEW INTERMEDIATE STRINGERS IN [illegible] [illegible] WAS [illegible] [illegible] WAS 28B077 (12) WT. CHG. [illegible]	[illegible]	[illegible]
E.O. A32275	M	IN B/M PBY-5 (41 ¢ ON) PBY-5A (53 ¢ ON) [illegible] 28B073 (2) WAS (4) 28B073 [illegible] NO WT. CHG.	[illegible]	[illegible]
E.O. A57188	N	Q4305-D4 WAS Q4303-D4. "G.S.'E ON -13 SIDE" REMOVED 28B5620-13. 28B5620-15 L.R. WAS 28B5620-7. Q4305-D6 (1) WAS AN442-D6 (1) WT. CHG. NEG.	[illegible]	[illegible]
E.O. B5874	P	REMOVED NOTE "SEE 28B5525 DETAIL E", REPLACED WITH "SEE DETAIL F", ADDED DETAIL F. CHG'D STOCK SIZE OF -8 FROM K5401X10 [illegible] TO K5401X9 [illegible] IN B/M. WT. CHG. NEG.	[illegible]	[illegible]
E.O. B18177	Q	IN B/M -7 L.R. Y2-A27RTX7 WAS -7 [illegible] K5401X7, -8 L.R. Y2-A27RTX10 [illegible] WAS -8 [illegible] K5401X10 [illegible]. NEG. WT. CHG.	[illegible]	[illegible]
	R	AC365-D632, AN505 D6-10, Q5761-K5-1.5, Q5761-K5-.75, IN THE L.H. COLUMN OF -2 ASS'Y. WERE SHOWN IN THE R.H. COLUMN OF -0 ASS'Y. NO. WT. CHG.	7-19-45	[illegible]
E.O. B26396	S	CHG'D DIRECTION OF ARROW AT DETAIL "F" NO WT. CHG.	10/15/45	MORRIS

LET	ALTERATION	DATE	BY	E.O.
A	ADDED CLIP 28B073 TO STRINGER NEAR CHINE, CLIP 28B075 TO OTHER STRINGERS, CLIPS ADDED TO B/M, 3½ DIMENSION ADDED TO -10 AS PER E.O. 15751	[illegible]	[illegible]	
B	-2 ASS'Y ADDED, -11 L.R. ADDED. Q2155-10-3 ADDED. E.O. 21260A LIP REMOVED FROM UPPER FLANGE	[illegible]	[illegible]	E.O. 227 PBY 28-51
C	ADDED -13 L.R. (1), AN425 D4, Q4303-D6 AS PER E.O. 25076A	[illegible]	[illegible]	
E	Q2155-14-7 WAS Q2155-14-8 BROUGHT REF. PLANE UP TO DWG. NO WT. CHG.			
F	CHANGED AN425-D4 TO Q4303-D4 NO WT. CHG.	10-29-41	[illegible]	W.O. FLOYD 12-28
G	ADDED 28B212, 28B1391, 28B1391-2, Q5761-K5-1.5 & .75, AN505-D6-10, AN365-D632, AND SECTION X-X. WT. CHG. NEG.	[illegible]	[illegible]	E.O. 229
H	28B5509 WAS 28B5525-11 NO WT. CHG.	6-2-42	[illegible]	E.O. 22348
J	ON FACE 28B5620-13 WAS -11. ADDED -13 L&R, CALL OUT TO FACE IN B/M, MAT'L .051X4 3/4X15 24SO 47AB-A WAS .072X3/4X1 1/2 24ST 47AB-T. Q2155-10-3 REPLACED L&R FOR -2 ASS'Y. NO WT. CHG.	4-2-42	[illegible]	E.O. A29371
K	REMOVED LIP FROM UPPER FLANGE. SECTION C-C ADDED. ⅛, 3/16 R 90° DIMS. TO SECT. X-X (NO WT. CHG.)	4-24-[illegible]	[illegible]	

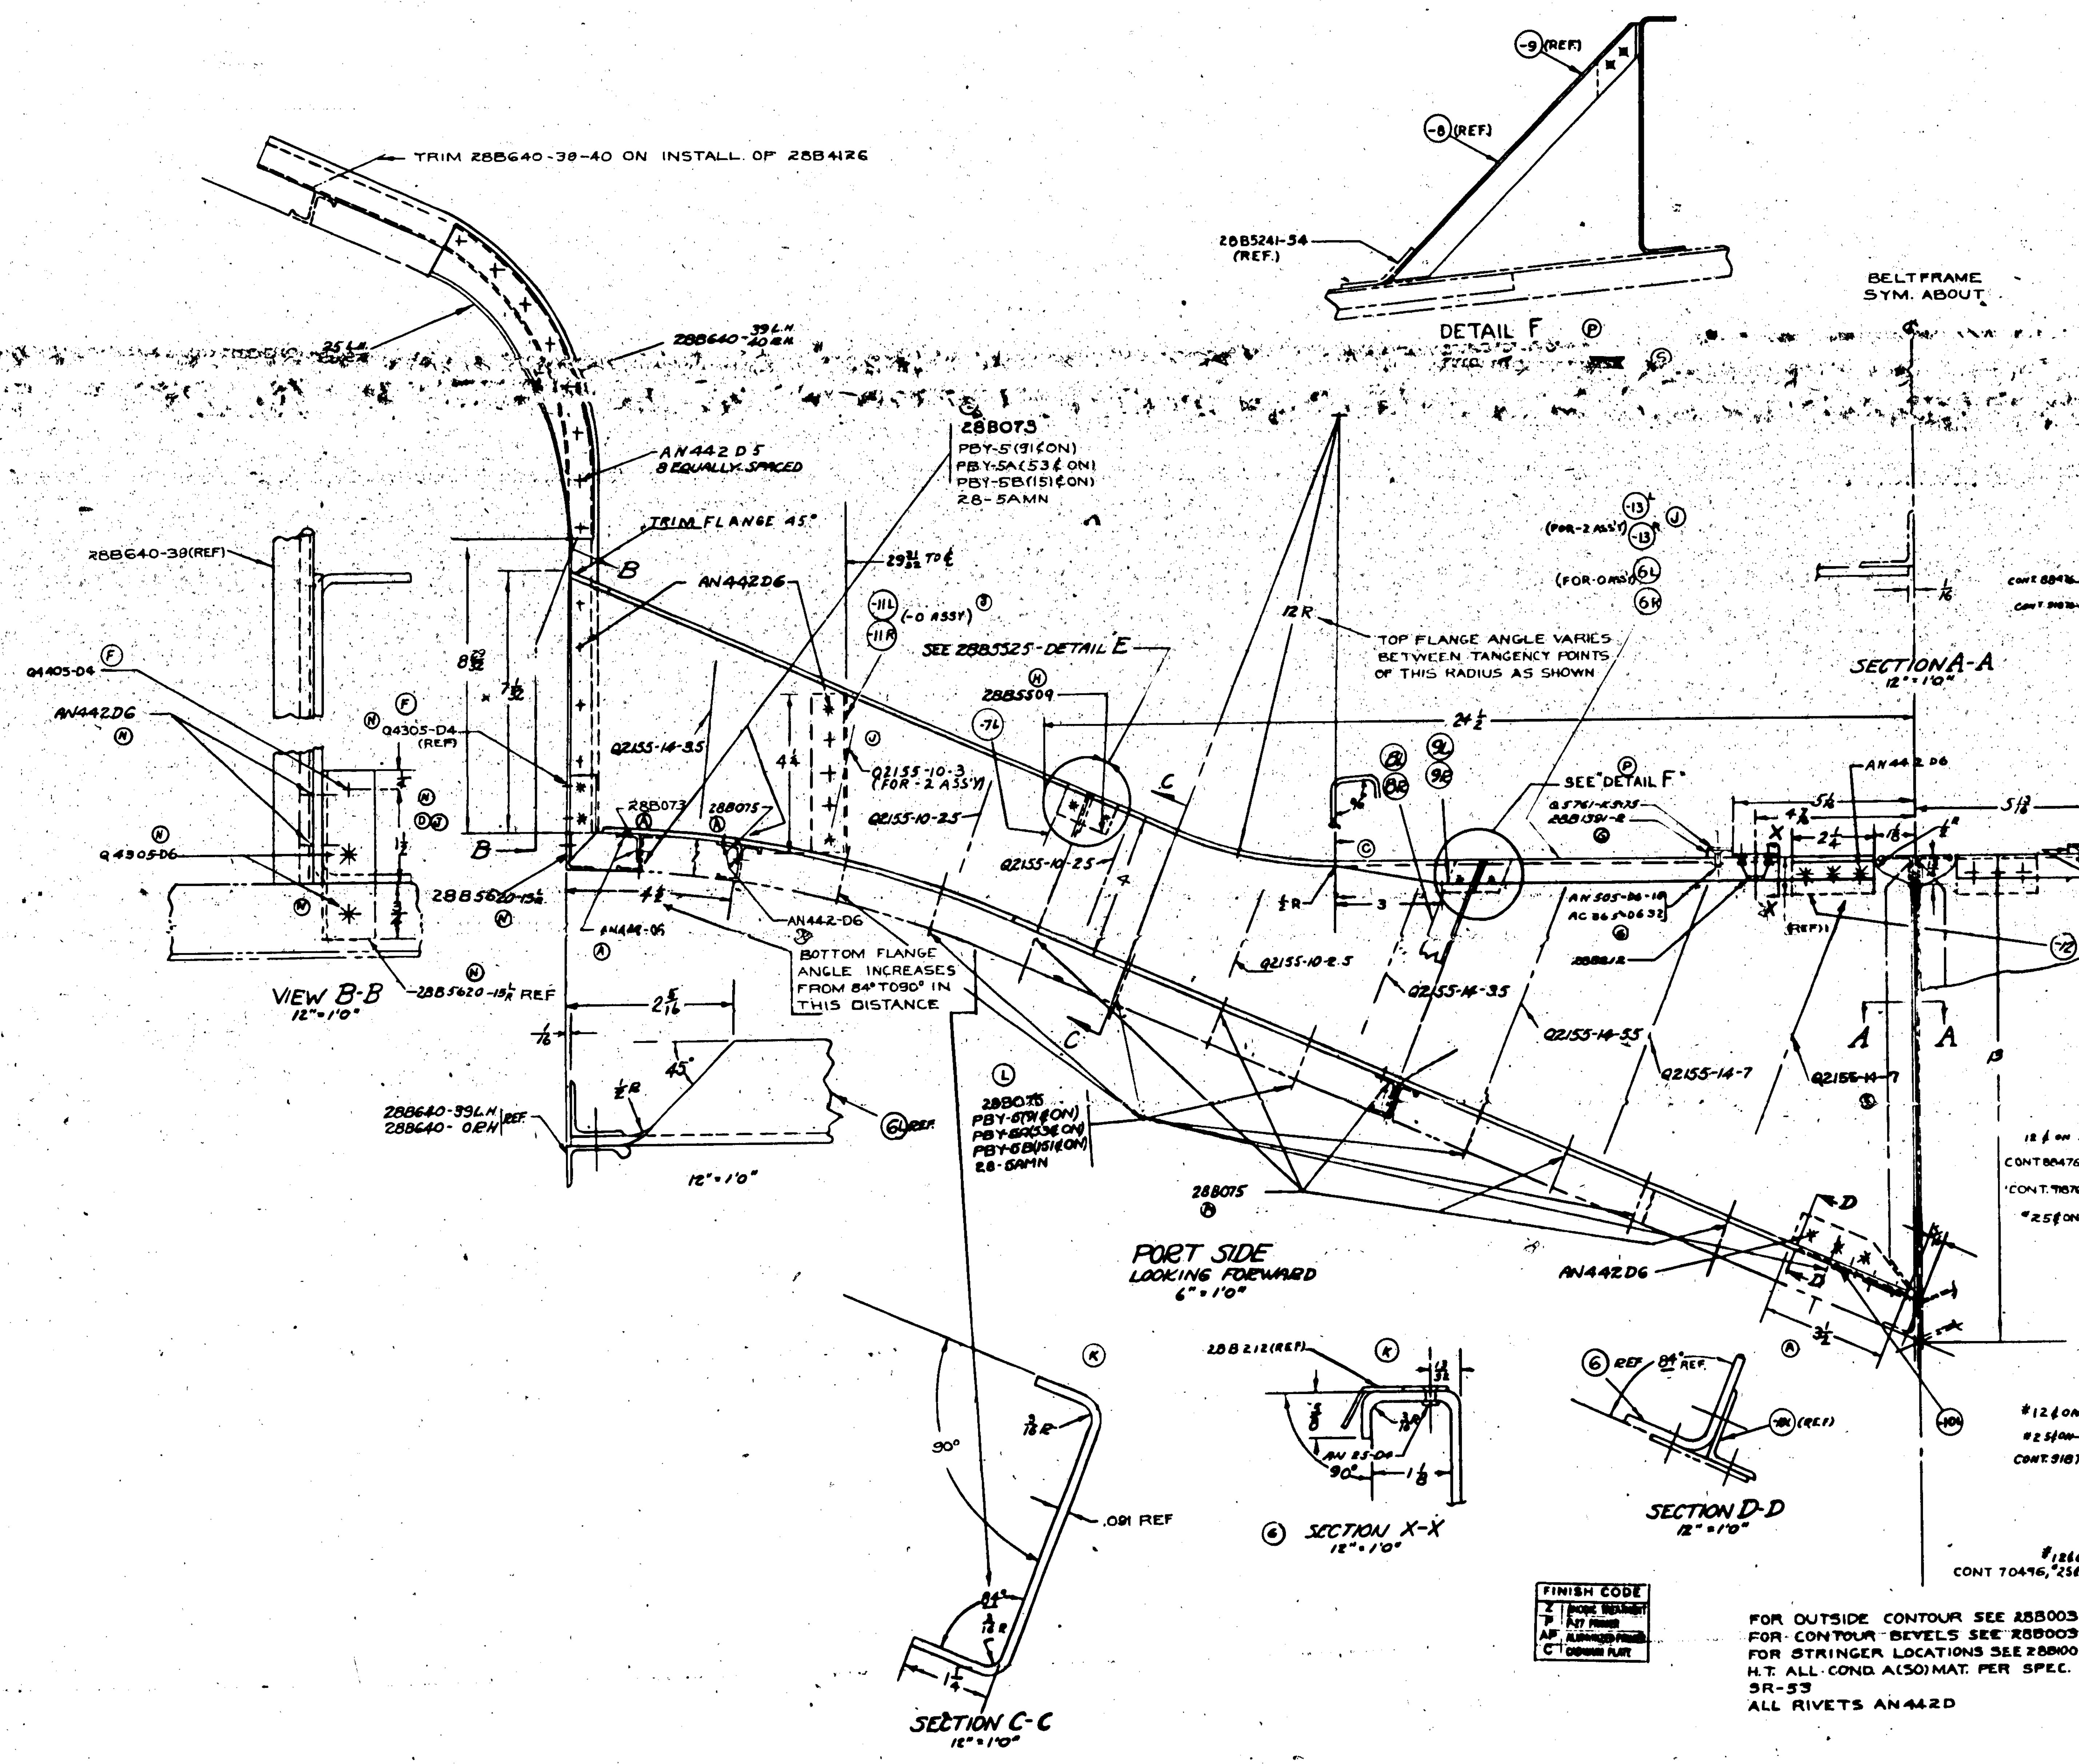

FOR OUTSIDE CONTOUR SEE 28B003
FOR CONTOUR BEVELS SEE 28B003
FOR STRINGER LOCATIONS SEE 28B1007
H.T. ALL COND. A(SO) MAT. PER SPEC.
SR-53
ALL RIVETS AN442D

FINISH CODE

Z	[illegible]
P	[illegible]
AF	[illegible]
C	[illegible]

H 154

SCALE	NOTED
HEAT TREAT	NOTED
FINISH	ZP-AP
NAME	BELTFRAME-HULL STA. # 6.4
DWG.	J 28B5640

CONSOLIDATED AIRCRAFT CORP.

28B5640 B